	Sanitized Copy Approved for Release 2011/09/19 : CIA-RDP78-03424A001100040096-2	
	CONFIDENTIAL Your 7.0.3	
1	The appearance of double characters on the messages received from	,
	either the transmit terminals is estimated by the contrac-	
	tor and HQ. to be due to the servo system of the Ferranti reader. This	
	trouble was encountered in previous operation from Occa-	
	sionally synchronization, as observed on the scope, (intensity modulated	
	spot on sawtooth waveform), could not be obtained throughout the entire	
	range of the inductor control, "Servo Control", which is used to syn-	
	chronize the 60-cycle servo oscillator pulses and sprocket hole output.	
	Observation of the servo amplifier voltage output (as read on the ampli-	
	fier meter) indicated a low voltage. Readjustment of this foltage	
	(amplifier gain adjustment on the amplifier chassis) to the rated	
	Ferranti motor voltage, 115 volts AC, she should correct this trouble.	
	Square wave should be observed on the self-contained scope at the point	
	of multiplex in transmit terminal. Transmission of RY tape to self	
	should indicate when trouble is cleared up. Suggest this self-checking	
	method should be done periodically.	
[		,
		2
1		

